

**PRODUCT DESCRIPTION**
**S.I.N.: 834-300**

Permatex Clear Silicone Adhesive Sealant is a general purpose, single component, room temperature vulcanizing (RTV) compound, designed for the sealing of mechanical assemblies. Upon curing from the exposure to moisture in the air, this non-sagging paste forms a tough, flexible, waterproof seal of silicone rubber, which resists aging, weathering and thermal cycling without hardening, shrinking or cracking.

**PRODUCT BENEFITS**

- Easy application
- Applied to horizontal or vertical surfaces
- Superior adhesion and flexibility
- Waterproofs
- Insulates
- Unaffected by vibration
- Non-flammable
- Non-toxic

**TYPICAL APPLICATIONS**

Permatex Clear Silicone Adhesive Sealant is an excellent all purpose adhesive/sealant for the following materials:


- Metal
- Glass
- Wood
- Plastic
- Silicone resin
- Vulcanized silicone rubber
- Ceramics
- Natural and synthetic fibres
- Painted surfaces

Bonds, seals, repairs, mends and secures:

- Lens housings
- Windshields
- Windows
- Door frames
- Vinyl tops
- Housings and covers

**DIRECTIONS FOR USE**
**For Assembly**

1. Remove all previous material from mating surfaces. Permatex Gasket Remover is recommended for most materials, not for plastics or painted surfaces.
2. For best results, clean and dry all surfaces with a residue-free solvent, such as Permatex Brake and Parts Cleaner.
3. Cut nozzle to desired bead size, 1.5mm to 6mm in diameter. An 3mm bead is usually sufficient for most applications.
4. Remove cap, puncture tube or cartridge seal and attach extension nozzle.
5. Apply a continuous and even bead of silicone to one surface.

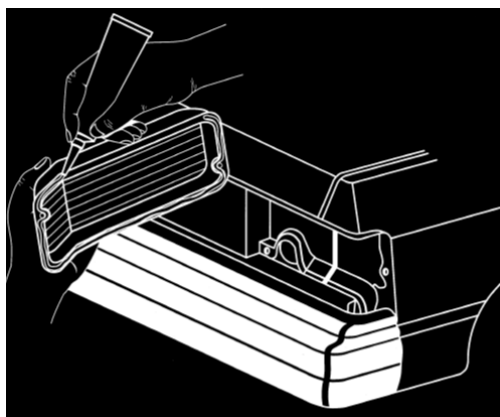

6. Assemble parts immediately while silicone is still wet. Secure or tighten as required, avoiding excessive squeeze-out.
7. Pressure should be applied to parts for 24 hours until the silicone is fully cured.

**Storage of Unused Product**

1. Create a "Silicone Plug" by allowing excess material to extend beyond the extension nozzle or aerosol tip to cure, sealing and protecting the remaining product from moisture. For reuse, simply remove the cured product from the tip.
2. For PowerBead dispensers, you may store remaining product using either the above "silicone plug" method or using the included plastic cap.

**FOR CLEANUP**

1. Remove uncured product from parts and hand-tools with Permatex® EnviroSafe® ODC Free Cleaner/Degreaser. If skinned over, break film with a dry cloth to remove as much as possible. Remove the remaining material with Permatex® Gasket Remover.
2. Clean hands with a dry cloth or Permatex Fast Orange hand cleaner.

**PROPERTIES OF UNCURED MATERIAL**

	<b>Typical Value</b>
Chemical Type	Acetoxy silicone rubber
Appearance	Clear, non-sag paste
Odour	Mild Acetic
Specific Gravity	1.01
Extrusion rate @25°C (grams/min)	>220
Flash Point	>93°C

## TYPICAL CURING PERFORMANCE

Permatex Clear Silicone Adhesive Sealant cures on exposure to moisture in the air. The product dries tack free in 1 hour and fully cures in 24 hours. Cure times will vary with temperature, humidity and gap. Note: The curing process can cause corrosion to some surfaces, for critical applications use the Ultra Series silicones.

## PERFORMANCE OF CURED MATERIAL

After 7 days at 25°C, 50% Relative Humidity

	Typical Values
Hardness (Shore A)	>20
Elongation, %*	>350
Tensile Strength, N/mm <sup>2</sup> **	>1.5

\*Material will stretch 3.5 times its original length before breaking.

\*\*Amount of force required to break material.

## TYPICAL ENVIRONMENTAL RESISTANCE

Temperature Resistance	Typical Values
Continuous, °C	-59 to 204
Intermittent, °C	-59 to 260

## GENERAL INFORMATION

This product is not recommended for use in pure oxygen and/or oxygen rich systems and should not be selected as a sealant for chlorine or other strong oxidizing materials.

For safe handling information on this product, consult the Material Safety Data Sheet, (MSDS).

## ORDERING INFORMATION

Part Number	Container Size
35562	80ml tube

## STORAGE

Products shall be ideally stored in a cool, dry location in unopened containers at a temperature between 8° to 28°C (46° to 82°F) unless otherwise labelled. Optimal storage is at the lower half of this temperature range. To prevent contamination of unused product, do not return any material to its original container.

## NOTE

The data contained herein are furnished for information only and are believed to be reliable. We cannot assume responsibility for the results obtained by others over whose methods we have no control. **Permatex Europe specifically disclaims all warranties expressed or implied, including warranties of merchantability or fitness for a particular purpose, arising from sale or use of Permatex Europe products and disclaims any liability for consequential or incidental damages of any kind, including lost profits.** This product may be covered by one or more United States or foreign patents or patent applications.